

EXECUTIVE SUMMARY

Thank you for your continued hard work sampling **Granite Lake** this year! Your monitoring group sampled the deep spot **three** times this year and has done so for many years. As you know, conducting multiple sampling events each year enables DES to more accurately detect water quality changes. Keep up the great work!

Volunteers from your lake participated in the Lake Host™ Program this year. The Lake Host™ Program is funded through DES and Federal grants. The program was developed in 2002 by NH LAKES and NHDES to educate and prevent boaters from spreading exotic aquatic plants to lakes/ponds in New Hampshire. Since then, the number of participating lakes/ponds and volunteers has doubled, the number of boats inspected has tripled, and the number of “saves” (exotic plants discovered) has increased from four in 2002 to a total of 297 in 2009. The program is invaluable in educating boaters and protecting NH’s waterbodies from exotic aquatic plant infestations, thereby preventing recreational hazards, property value decline, aquatic ecosystem decline, aesthetic issues, and saving costly remediation efforts. Lake Host™ staff made **one** “save” at your lake and discovered the following aquatic vegetation entering or leaving your lake in 2009:

Native milfoil (native)

Tapegrass (native)

Curly Leaf Pondweed (exotic)

Terrestrial Vine Species (native)

Great work! We encourage volunteers to continue participating in the Lake Host™ Program to protect the future of your lake.

In 2008, the Granite Lake Association received a DES Local Watershed Initiative Grant to develop a watershed based plan for the Granite Lake Watershed. Granite Lake is considered a high quality water and the Lake Association and towns of Nelson and Stoddard would like it to remain that way.

The focus of the watershed management plan will be reducing phosphorus inputs, the limiting nutrient for algal growth that greatly impacts the aging rate of a lake. Lake aging or eutrophication, can result in an increase in algal and plant growth, an increase in toxic cyanobacteria blooms, a reduction in water clarity and a reduction in lake oxygen concentrations that negatively impact aquatic life, including fish, and species that depend on them as a food source.

The Granite Lake Association has hired an Environmental Consultant, AECOM, to assist coordinating and developing the watershed based plan. The Granite Lake Association and AECOM have completed several tasks to date including development of a water quality advisory committee and establishing a water quality goal for Granite Lake. For more information, visit the Granite Lake Association website at www.granitelake.org.

OBSERVATIONS & RECOMMENDATIONS

DEEP SPOT

➤ Chlorophyll-a

Chlorophyll-a, a pigment found in plants, is an indicator of algal or cyanobacteria abundance. Algae are typically microscopic plants that are naturally found in the lake ecosystem. The measurement of chlorophyll-a in the water gives biologists an estimation of the algal concentration or lake productivity. Table 14 in Appendix A lists the current year chlorophyll-a data.

Figure 1 depicts the historical and current year chlorophyll-a concentration in the water column.

The median summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 4.58 mg/m³.

The current year data (the top graph) show that the chlorophyll-a concentration **increased gradually** from **June** to **August**.

The historical data (the bottom graph) show that the **2009** chlorophyll-a mean is ***much less than*** the state median and is ***slightly greater than*** the similar lake median. For more information on the similar lake median, refer to Appendix D.



Overall, visual inspection of the historical data trend line (the bottom graph) shows a ***relatively stable*** in-lake chlorophyll-a trend since monitoring began. Specifically the mean chlorophyll concentration has ***remained approximately the same*** since **1989**.

While algae are naturally present in all waterbodies, an excessive or increasing amount of any type is not welcomed. Phosphorus is the nutrient that algae typically depend upon for growth in New Hampshire lakes and ponds. Algal concentrations increase as nonpoint sources of phosphorus from the watershed increase, or as in-lake phosphorus sources increase. Increased Chlorophyll-a concentrations can also affect water clarity, causing Secchi-disk transparency to decrease (worsen) and turbidity to increase (worsen).

Therefore, it is extremely important for volunteer monitors to continually educate all watershed residents about management practices that can be implemented to minimize phosphorus loading to surface waters.

Granite Lake, Stoddard

Figure 1. Monthly and Historical Chlorophyll-a Results

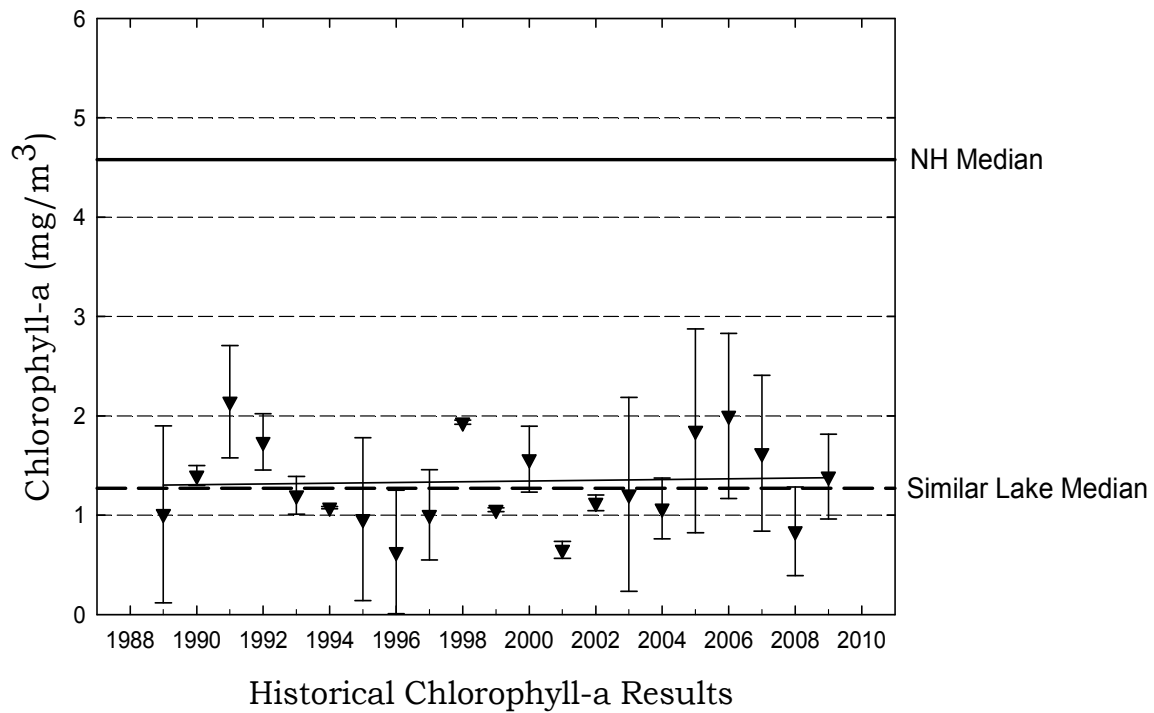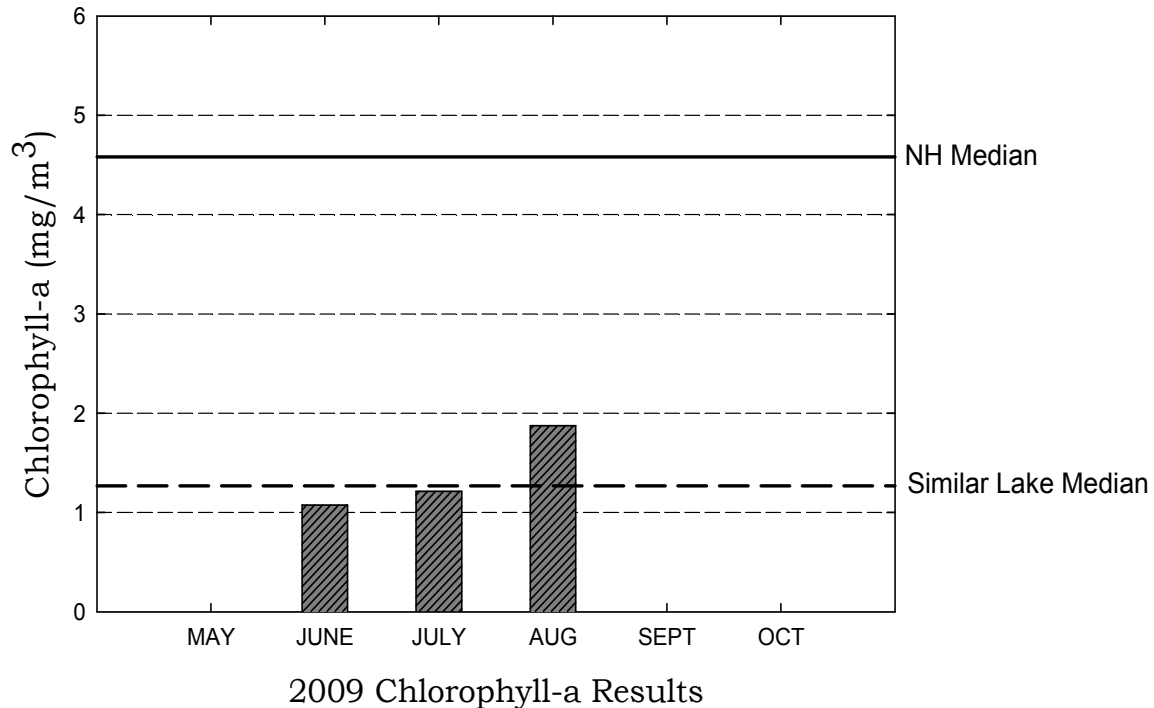

➤ **Phytoplankton and Cyanobacteria**

Table 1 lists the phytoplankton (algae) and/or cyanobacteria observed in the pond in **2009**. Specifically, this table lists the three most dominant phytoplankton and/or cyanobacteria observed and their relative dominance in the sample.

Table 1. Dominant Phytoplankton/Cyanobacteria (July 2009)

Division	Genus	% Dominance
Chrysophyta	Uroglenopsis	83.2
Chrysophyta	Dinobryon	4.4
Bacillariophyta	Asterionella	4.4

Phytoplankton populations undergo a natural succession during the growing season. Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding seasonal plankton succession. Diatoms and golden-brown algae populations are typical in New Hampshire’s less productive lakes and ponds.

➤ **Secchi Disk Transparency**

Volunteer monitors use the Secchi disk, a 20 cm disk with alternating black and white quadrants, to measure how far a person can see into the water. Transparency, a measure of water clarity, can be affected by the amount of algae and sediment in the water, as well as the natural color of the water. Table 14 in Appendix A lists the current year transparency data. **The median summer transparency for New Hampshire’s lakes and ponds is 3.2 meters.**

Figure 2 depicts the historical and current year transparency *with and without* the use of a viewscope.

The current year *non-viewscope* in-lake transparency *increased* from **June** to **July**, and then *decreased slightly* from **July** to **August**.

The current year *viewscope* in-lake transparency *increased* from **June** to **July** and then *decreased* from **July** to **August**.

The transparency measured with the viewscope was generally *greater than* the transparency measured without the viewscope this summer. A comparison of the transparency readings taken with and without the use of a viewscope shows that the viewscope typically increases the depth to which the Secchi disk can be seen into the lake, particularly on sunny and windy days. We recommend that your group measure Secchi disk transparency with and without the viewscope on each sampling event.

It is important to note that viewscope transparency data are not compared to a New Hampshire median or similar lake median. This is because lake transparency with the use of a viewscope has not been historically measured by DES. In the future, the New Hampshire and similar lake medians for viewscope transparency will be calculated and added to the appropriate graphs.

The historical data (the bottom graph) show that the **2009** mean non-viewscope transparency is ***much greater than*** the state median and is ***slightly greater than*** the similar lake median. Please refer to Appendix D for more information about the similar lake median.


Visual inspection of the historical data trend line (the bottom graph) shows an ***increasing*** trend, meaning that the transparency has ***improved*** since monitoring began in **1989**.

Typically, high intensity rainfall causes sediment-laden stormwater runoff to flow into surface waters, thus increasing turbidity and decreasing clarity. Efforts should continually be made to stabilize stream banks, pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the pond. Guides to best management practices that can be implemented to reduce, and possibly even eliminate, nonpoint source pollutants, are available from DES upon request.


We recommend that your group continue to measure the transparency with and without the use of the viewscope on each sampling event. Ultimately, we would like all monitoring groups to use a viewscope to take Secchi disk readings as the use of the viewscope results in less variability in transparency readings between monitors and sampling events. At some point in the future, when we have sufficient data to determine a statistical relationship between transparency readings collected with and without the use of a viewscope, it may only be necessary to collect transparency readings with the use of a viewscope.

Granite Lake, Stoddard

Figure 2. Monthly and Historical Transparency Results

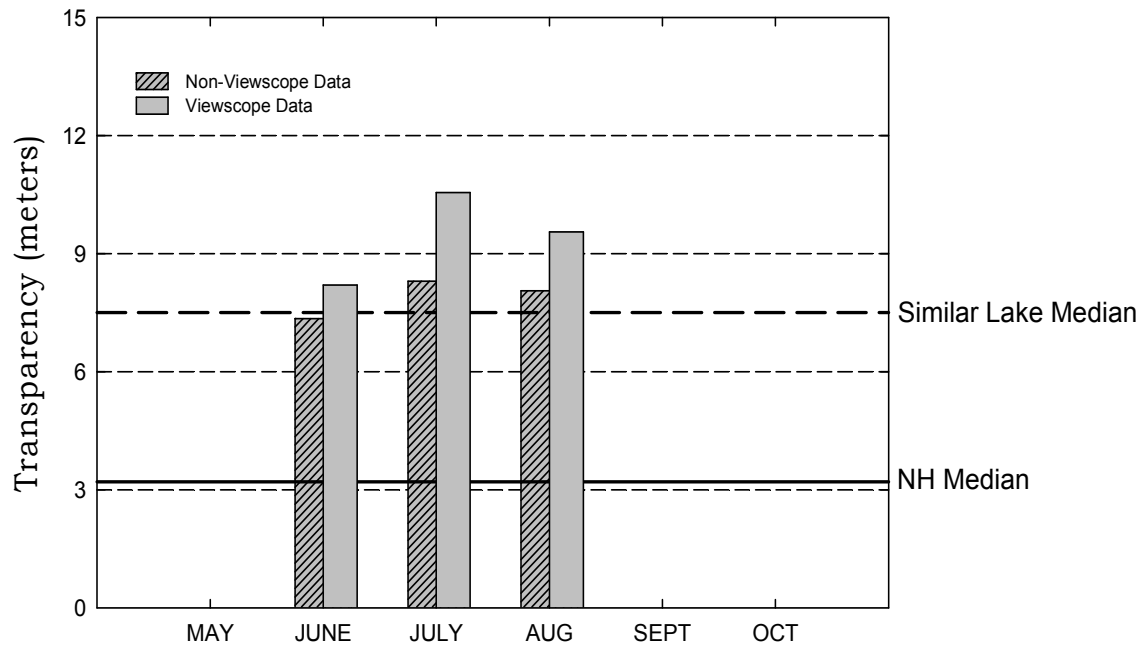

2009 Transparency Viewscape and Non-Viewscape Results

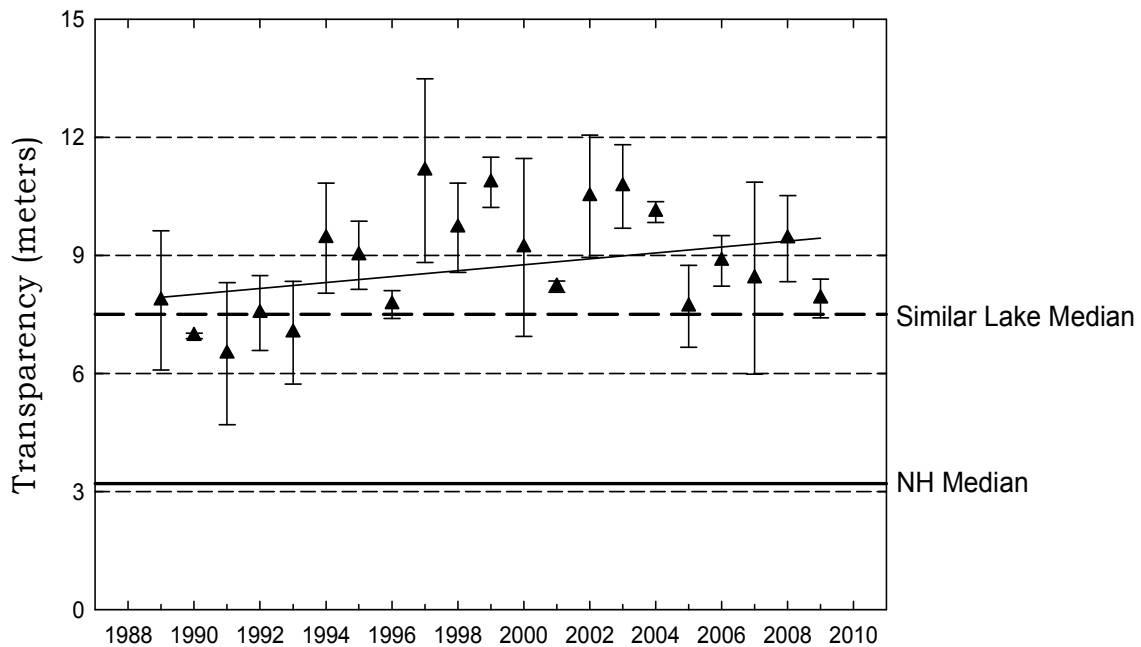

Historical Transparency Non-Viewscape Results

➤ **Total Phosphorus**

Phosphorus is typically the limiting nutrient for vascular plant and algae growth in New Hampshire's lakes and ponds. Excessive phosphorus in a pond can lead to increased plant and algal growth over time. Table 14 in Appendix A lists the current year total phosphorus data for in-lake and tributary stations.

The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 12 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The graphs in Figure 3 depict the historical amount of epilimnetic (upper layer) and hypolimnetic (lower layer) total phosphorus concentrations; the inset graphs depict current year total phosphorus data.

The current year data for the epilimnion (the top inset graph) show that the phosphorus concentration **decreased greatly** from **June** to **July**, and then **increased** from **July** to **August**.

The **elevated** epilimnetic phosphorus concentration measured on the **June** sampling event may have been due to phosphorus-enriched stormwater runoff that flowed into the surface layer of the lake. Weather records indicate that approximately rainfall while sampling and in the **24 hours** prior to sampling.

The historical data show that the **2009** mean epilimnetic phosphorus concentration is **less than** the state median and is **greater than** the similar lake median. Refer to Appendix D for more information about the similar lake median.

The current year data for the hypolimnion (the bottom inset graph) show that the phosphorus concentration **increased** from **June** to **July**, and then **remained stable** from **July** to **August**.

The historical data show that the **2009** mean hypolimnetic phosphorus concentration is **much less than** the state median and is **slightly less than** the similar lake median. Please refer to Appendix D for more information about the similar lake median.



Overall, visual inspection of the epilimnetic historical data trend line shows a **relatively stable** phosphorus trend. Specifically, the mean annual epilimnetic phosphorus concentration has **remained approximately the same** since monitoring began in **1989**.

Overall, visual inspection of the hypolimnetic historical data trend line shows a **slightly variable** phosphorus trend since monitoring began. Specifically the mean annual concentration has **fluctuated between approximately 3 and 11 ug/L** since monitoring began in **1989**.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about the watershed sources of phosphorus and how excessive phosphorus loading can negatively affect the ecology and the recreational, economical, and ecological value of lakes and ponds.

Granite Lake, Stoddard

Figure 3. Monthly and Historical Total Phosphorus Data

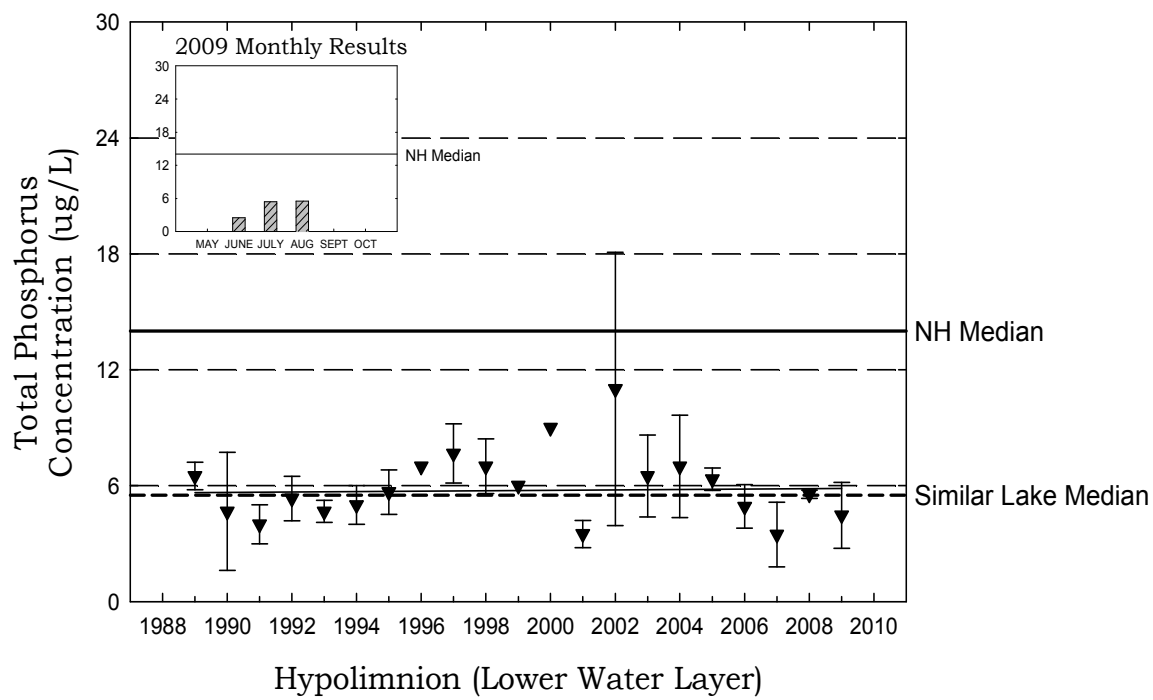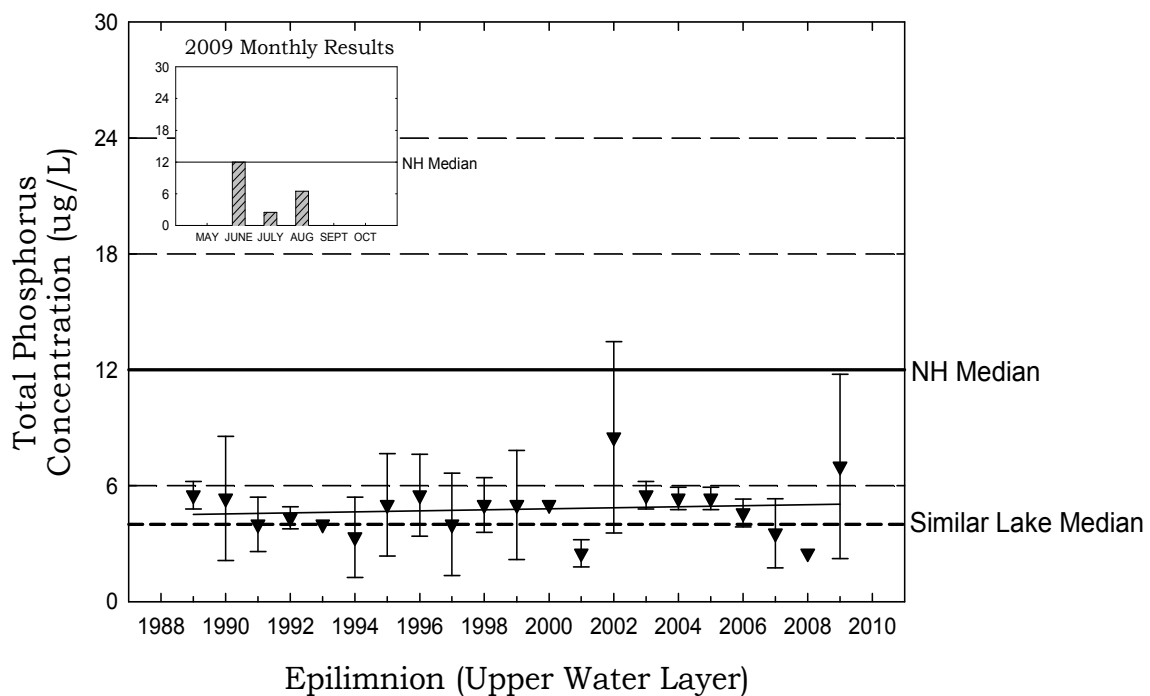

➤ pH

Table 14 in Appendix A presents the current year pH data for the in-lake stations.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 6.0 typically limits the growth and reproduction of fish. A pH between 6.0 and 7.0 is ideal for fish. The median pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is **6.6**, which indicates that the state surface waters are slightly acidic. For a more detailed explanation regarding pH, please refer to the "Chemical Monitoring Parameters" section of this report.

The pH at the deep spot this year ranged from **6.14 to 6.57** in the epilimnion and from **5.73 to 5.92** in the hypolimnion, which means that the water is ***slightly acidic***.

It is important to point out that the hypolimnetic (lower layer) pH was ***lower (more acidic)*** than in the epilimnion (upper layer). This increase in acidity near the bottom is likely due to the decomposition of organic matter and the release of acidic by-products into the water column.

Due to the state's abundance of granite bedrock and acid deposition received from snowmelt, rainfall, and atmospheric particulates, there is little that can be feasibly done to effectively increase pond pH. The pH at the deep spot, however, is sufficient to support aquatic life.

➤ Acid Neutralizing Capacity (ANC)

Table 14 in Appendix A presents the current year epilimnetic ANC for the deep spot.

Buffering capacity (ANC) describes the ability of a solution to resist changes in pH by neutralizing the acidic input. The median ANC value for New Hampshire's lakes and ponds is **4.9 mg/L**, which indicates that many lakes and ponds in the state are at least "moderately vulnerable" to acidic inputs. For a more detailed explanation about ANC, please refer to the "Chemical Monitoring Parameters" section of this report.

The acid neutralizing capacity (ANC) of the epilimnion (upper layer) ranged from **0.9 mg/L to 1.8 mg/L**. This indicates that the lake is ***extremely vulnerable*** to acidic inputs.

➤ Conductivity

Table 14 in Appendix A presents the current conductivity data for in-lake

stations.

Conductivity is the numerical expression of the ability of water to carry an electric current, which is determined by the number of negatively charged ions from metals, salts, and minerals in the water column. The median conductivity value for New Hampshire's lakes and ponds is **40.0 uMhos/cm**. For a more detailed explanation, please refer to the "Chemical Monitoring Parameters" section of this report.

The conductivity has **increased slightly** in the lake since monitoring began. In addition, the in-lake conductivity is **slightly greater than** the state median. Typically, increasing conductivity indicates the influence of pollutant sources associated with human activities. These sources include failed or marginally functioning septic systems, agricultural runoff, and road runoff which contains road salt during the spring snow-melt. New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could also contribute to increasing conductivity. In addition, natural sources, such as iron and manganese deposits in bedrock, can influence conductivity.

It is likely that de-icing materials applied to nearby roadways during the winter months may be influencing the conductivity in the lake. In New Hampshire, the most commonly used de-icing material is salt (sodium chloride).

*A limited amount of chloride sampling was conducted during **2009**. Please refer to the chloride discussion for more information.*

Therefore, we recommend that the **epilimnion** (upper layer) be sampled for chloride next year. This additional sampling may help us identify what areas of the watershed are contributing to the increasing in-lake conductivity.

Please note that the DES Limnology Center in Concord is able to conduct chloride analyses, free of charge. As a reminder, it is best to conduct chloride sampling in the spring as the snow is melting and during rain events.

➤ **Dissolved Oxygen and Temperature**

Table 9 in Appendix A depicts the dissolved oxygen/temperature profile(s) collected during **2009**.

The presence of sufficient amounts of dissolved oxygen in the water column is vital to fish and amphibians and also to bottom-dwelling organisms. Please refer to the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

The dissolved oxygen concentration was **high** at all deep spot depths sampled at the lake on the **July** sampling event. As thermally stratified lakes age, and as the summer progresses, oxygen typically becomes **depleted** in the hypolimnion (lower layer) by the process of decomposition. Specifically, the loss

of oxygen in the hypolimnion results primarily from biological organisms using oxygen to break down organic matter, both in the water column and particularly at the bottom of the lake where the water meets the sediment. The **high** oxygen level in the hypolimnion is a sign of the lake's overall good health. We hope this continues!

➤ **Turbidity**

Table 14 in Appendix A presents the current year data for in-lake turbidity.

Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to the "Other Monitoring Parameters" section of this report for a more detailed explanation.

The deep spot turbidity was **relatively low** this year, which is good news.

However, we recommend that your group sample the pond and any surface water runoff areas during significant rain events to determine if stormwater runoff contributes turbidity and phosphorus to the lake.

For a detailed explanation on how to conduct rain event sampling, please refer to the 2002 VLAP Annual Report special topic article, which is posted on the VLAP website at

<http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

TRIBUTARY SAMPLING

➤ **Total Phosphorus**

Table 14 in Appendix A presents the current year total phosphorus data for tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a detailed explanation of total phosphorus.

Spring run-off sampling was conducted on **4/16/2009**. Phosphorus concentrations at **431 North Shore Rd. and 558 Granite Lake Rd.** were ***slightly elevated (16 and 13 ug/L)***. The turbidity of the samples was also ***slightly elevated (3.55 and 1.77 ug/L)***.

During spring snowmelt and rain events, nutrient concentrations can spike as sand, salt, and other debris concentrated along roadsides enter tributaries through runoff. Phosphorus sources in the watershed can include agricultural runoff, failing or marginal septic systems, stormwater runoff, road runoff, and watershed development.

The phosphorus concentration in the **North Shore Rd Bridge Pipe** sample on the **July** sampling event was ***elevated (51 ug/L)***, and the turbidity was also ***slightly elevated (1.62 NTUs)***.

The phosphorus concentration in the **Little Granite Lake Outlet and Logging Road** sample on the **August** sampling event was ***slightly elevated (20 and 15 ug/L)***, and the turbidity was also ***slightly elevated (1.56 and 1.16 NTUs)***.

It had rained approximately **1.0 inch** during the **24-72 hours** prior to the **July and August** sampling events. Rain events typically carry phosphorus laden watershed runoff and suspended solids into the tributaries. Phosphorus sources in the watershed can include agricultural runoff, failing or marginal septic systems, stormwater runoff, road runoff, and watershed development.

Sediment and/or organic material often increase turbidity levels. These materials typically contain attached phosphorus and when present in elevated amounts contribute to elevated tributary phosphorus levels.

➤ **pH**

Table 14 in Appendix A presents the current year pH data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation of pH.

The pH of the tributaries appears to be slightly acidic. This can be caused by the presence of humic, tannic and fulvic acids. Humic, tannic and fulvic acids naturally occur as a result of decomposing organic matter such as leaves. These acids may also cause the water to be tea colored. In New Hampshire the

presence of granite bedrock and acid deposition also naturally lowers the pH of freshwaters.

➤ **Conductivity**

Table 14 in Appendix A presents the current conductivity data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a more detailed explanation of conductivity.

The conductivity along the **North Shore Road** stations is **low**. Typically conductivity levels greater than 100 uMhos/cm indicate the influence of pollutant sources associated with human activities. These sources include septic system leachate, agricultural runoff, and road runoff which contains road salt during the spring snow-melt. We hope this trend continues!

The conductivity along the **Granite Lake Road** stations is **elevated**. In addition, the conductivity is **much greater than** the state median. These stations are culverts draining runoff from Rt. 202/9, a major roadway for the state. It is likely that de-icing materials, specifically sodium chloride, applied to the roadway during the winter months are contributing to the elevated conductivity.

Therefore, we recommend that the **Granite Lake Road** stations be sampled for chloride next year. This additional sampling may help us identify what areas of the watershed are contributing to the increasing in-lake conductivity.

*A limited amount of chloride sampling was conducted during **2009**. Please refer to the chloride discussion for more information.*

Please note that the DES Limnology Center in Concord is able to conduct chloride analyses, free of charge. As a reminder, it is best to conduct chloride sampling in the spring as the snow is melting and during rain events.

➤ **Turbidity**

Table 14 in Appendix A presents the current year turbidity data for the tributary stations. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation of turbidity.

Overall, **2009** tributary turbidity levels were **similar** to historical tributary turbidity levels.

The **614 Granite Lake Rd, 558 Granite Lake Rd, 431 North Shore Rd, 628 North Shore Rd, Inlet, Little Granite Lake Outlet, Logging Road, and North Shore Road Bridge Pipe** experienced turbid conditions throughout the summer, likely the result of stormwater runoff from significant rain events prior to sampling. Rainfall creates runoff that washes sediment and organic materials into tributaries causing turbid water conditions. Eventually, the

suspended solids settle out once the flow is reduced or the tributary flow enters the lake.

➤ **Bacteria (*E. coli*)**

Table 14 in Appendix A lists the current year data for bacteria (*E.coli*) testing. *E. coli* is a normal bacterium found in the large intestine of humans and other warm-blooded animals. *E.coli* is used as an indicator organism because it is easily cultured and its presence in the water, in defined amounts, indicates that sewage **may** be present. If sewage is present in the water, potentially harmful disease-causing organisms **may** also be present. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation.

Bacteria sampling was not conducted this year. If residents are concerned about sources of bacteria such as failing septic systems, animal waste, or waterfowl waste, it is best to conduct *E. coli* testing when the water table is high, when beach use is heavy, or immediately after rain events.

➤ **Chlorides**

Table 14 in Appendix A lists the current year data for chloride sampling. The chloride ion (Cl⁻) is found naturally in some surface waters and groundwaters and in high concentrations in seawater. Research has shown that elevated chloride levels can be toxic to freshwater aquatic life. In order to protect freshwater aquatic life in New Hampshire, the state has adopted **acute and chronic** chloride criteria of **860 and 230 mg/L** respectively. The chloride content in New Hampshire lakes is naturally low, generally less than 2 mg/L in surface waters located in remote areas away from habitation. Higher values are generally associated with salted highways and, to a lesser extent, with septic inputs. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

210, 305, 395, 431, and 628 North Shore Rd, 624 Granite Lake Rd, Foxweldon, North Shore End, North Shore West Shore, and Warren Drive were sampled for chloride on the **4/16/2009** sampling event. The results were all **5 mg/L or less**, which is ***much less than*** the state acute and chronic chloride criteria.

558, 586, 603, 614, 657, and 668 Granite Lake Rd, Inlet, Outlet in Stream, and Townline Inlet were sampled for chloride on the **4/16/2009** sampling event. The results ranged from **7.3 to 77 mg/L**, which is ***much less than*** the state acute and chronic chloride criteria, however ***greater than*** what we would expect to see in surface waters of the state.

We recommend that your monitoring group continue to conduct chloride sampling in the epilimnion, Granite Lake Rd. and Townline Inlet, particularly in the spring during snow-melt and during rain events during the summer. This

will establish a baseline of data that will assist your monitoring group and DES to determine lake quality trends in the future.

Please note that chloride analyses can be run free of charge at the DES Limnology Center. Please contact the VLAP Coordinator if you are interested in chloride monitoring.

DATA QUALITY ASSURANCE AND CONTROL

Annual Assessment Audit

During the annual visit to your pond, the biologist conducted a sampling procedures assessment audit for your monitoring group. Specifically, the biologist observed the performance of your monitoring group while sampling and filled-out an assessment audit sheet to document the volunteer monitors' ability to follow the proper field sampling procedures, as outlined in the VLAP Monitor's Field Manual. This assessment is used to identify any aspects of sample collection in which volunteer monitors failed to follow proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples volunteer monitors collect are truly representative of actual lake and tributary conditions.

Overall, your monitoring group did an **excellent** job collecting samples on the annual biologist visit this year! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the biologist to provide additional training. Keep up the good work!

Sample Receipt Checklist

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if your group followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did a **very good** job when collecting samples this year! Specifically, the members of your monitoring group followed the majority of the proper field sampling procedures when collecting and submitting samples to the laboratory. However, the laboratory did identify a few aspects of sample collection that your group could improve upon, as follows:

- **Sample bottle volume:** Please fill each sample bottle up to the neck of the bottle where the bottle curves in. This will ensure that the laboratory staff will have enough sample water to conduct all of the necessary tests.

2009

Please be careful to not overflow the small brown bottle used for phosphorus sampling since this bottle contains acid. If you do accidentally overflow the small brown bottle, please rinse your hands and the outside of the sample bottle and make a note of this on your field sampling sheet. The laboratory staff will put additional acid in the bottle in the laboratory to preserve the sample.

USEFUL RESOURCES

Acid Deposition Impacting New Hampshire's Ecosystems, DES fact sheet ARD-32, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/ard/documents/ard-32.pdf.

Best Management Practices to Control Nonpoint Source Pollution: A Guide for Citizens and Town Officials, DES Booklet WD-03-42, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-03-42.pdf.

Erosion Control for Construction in the Protected Shoreland Buffer Zone, DES fact sheet WD-SP-1, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-1.pdf>

Low Impact Development Hydrologic Analysis. Manual prepared by Prince George's County, Maryland, Department of Environmental Resources. July 1999. To access this document, visit www.epa.gov/owow/nps/lid_hydr.pdf or call the EPA Water Resource Center at (202) 566-1736.

Low Impact Development: Taking Steps to Protect New Hampshire's Surface Waters, DES fact sheet WD-WMB-17, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/wmb/documents/wmb-17.pdf.

NH Stormwater Management Manual Volume 1: Stormwater and Antidegradation, DES fact sheet WD-08-20A, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20a.pdf>

NH Stormwater Management Manual Volume 2: Post-Construction Best Management Practices Selection and Design, DES fact sheet WD-08-20B, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20b.pdf>

NH Stormwater Management Manual Volume 3: Erosion and Sediment Controls During Construction, DES fact sheet WD-08-20C, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20c.pdf>

Road Salt and Water Quality, DES fact sheet WD-WMB-4, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/wmb/documents/wmb-4.pdf.